



Pre-Shipment Inspection

PO#/CUSTOMER	-	Mill Name	-
--------------	---	-----------	---

Product Name	1. INTERIOR FLUSH DOOR 44 x 762 x 2743 2. INTERIOR FLUSH DOOR 44 x 914 x 2743 3. INTERIOR FLUSH DOOR 44 x 406 x 2438 4. INTERIOR FLUSH DOOR 44 x 610 x 2438 5. INTERIOR FLUSH DOOR 44 x 813 x 2438	Inspection Date	25/01/2023
		Order Completion Date	

A. Order Detail

Product	Dimensions	Core	Produced Qty	Inspected Qty	Sample Size
INTERIOR FLUSH DOOR	44 x 762 x 2743	Falcata	22	3	13.6%
INTERIOR FLUSH DOOR	44 x 914 x 2743	Falcata	22	3	13.6%
INTERIOR FLUSH DOOR	44 x 406 x 2438	PB	44	3	6.8%
INTERIOR FLUSH DOOR	44 x 610 x 2438	PB	22	3	13.6%
INTERIOR FLUSH DOOR	44 x 813 x 2438	PB	22	3	13.6%



Pre-Shipment Inspection

B. Measurement Check

Product Name		INTERIOR FLUSH DOOR		Dimensions (mm)			
				44 x 762 x 2743			
Item	Thickness (mm)	Width (mm)	Squareness (mm)	Length (mm)	Defects	Finish	Remarks
1	44.24	761	0	2742	-	√	OK
2	44.56	762	1	2743	-	√	OK
3	44.11	762	0.5	2743	-	√	OK

C. Moisture Content Check

Product	Specification	Actual Moisture Content (%)			Average (%)	Result
INTERIOR FLUSH DOOR 44 x 762 x 2743	MC Product (8-12%)	7	8	7	6.8	OK
		7	7.5	6.5		
		6.5	6.5	6		

D. Visual Check

Item	Description of Defects	Qty (pcs)	Remarks
1	Coating Crack		
2	Chipping		
3	Missed Painting		
4	Uneven Coating		
5	Bubble/Fisheye		
6	Pinhole		
7	Paint Build-up		
8			
9			
Sample check		pcs	
Total Defect		Minor	
		Major	

Pre-Shipment Inspection

E. Evidence

Item : Interior Flush Door | Dimension (mm) : 44 x 762 x 2743

Thickness	Thickness
	
Width	Width
	
Length	Length
	

Pre-Shipment Inspection

Moisture Content	Moisture Content
	
Stile Size	Mid Rail Size
N/A	N/A
Top Rail Size	Bottom Rail Size
N/A	N/A

Visual Findings

Minor Defect	Major Defect
N/A	N/A



Pre-Shipment Inspection

F. Measurement Check

Product Name		INTERIOR FLUSH DOOR		Dimensions (mm)			
				44 x 914 x 2743			
Item	Thickness (mm)	Width (mm)	Squareness (mm)	Length (mm)	Defects	Finish	Remarks
1	44.05	913.5	0	2743	-	√	OK
2	43.96	914	1	2743	-	√	OK
3	44.05	913	0	2743	-	√	OK

G. Moisture Check

Product	Specification	Actual Moisture Content (%)			Average (%)	Result
INTERIOR FLUSH DOOR 44 x 914 x 2743	MC Product (8-12%)	6.5	6	6	7.9	OK
		9	9.5	8		
		9	8.5	8.5		

H. Visual Check

Item	Description of Defects	Qty (pcs)	Remarks
1	Coating Crack		
2	Chipping		
3	Missed Painting		
4	Uneven Coating		
5	Bubble/Fisheye		
6	Pinhole		
7	Paint Build-up		
8			
9			
Sample check		pcs	
Total Defect		Minor	
		Major	

Pre-Shipment Inspection

I. Evidence

Item : Interior Flush Door | Dimension (mm) : 44 x 914 x 2743

Thickness	Thickness
	
Width	Width
	
Length	Length
	

Pre-Shipment Inspection

Moisture Content	Moisture Content
	
Stile Size	Mid Rail Size
N/A	N/A
Top Rail Size	Bottom Rail Size
N/A	N/A

Visual Findings

Minor Defect	Major Defect
N/A	N/A



Pre-Shipment Inspection

J. Measurement Check

Product Name		INTERIOR FLUSH DOOR		Dimensions (mm)			
				44 x 406 x 2438			
Item	Thickness (mm)	Width (mm)	Squareness (mm)	Length (mm)	Defects	Finish	Remarks
1	44.34	406	0	2438	-	√	OK
2	44.33	406	0	2438	-	√	OK
3	44.33	406	0	2438	-	√	OK

K. Moisture Content Check

Product	Specification	Actual Moisture Content (%)			Average (%)	Result
INTERIOR FLUSH DOOR 44 x 406 x 2438	MC Product (8-12%)	8.5	8.5	8.5	8.4	OK
		9	8.5	9		
		8	8	8		

L. Visual Check

Item	Description of Defects	Qty (pcs)	Remarks
1	Coating Crack		
2	Chipping		
3	Missed Painting		
4	Uneven Coating		
5	Bubble/Fisheye		
6	Pinhole		
7	Paint Build-up		
8			
9			
Sample check		pcs	
Total Defect		Minor	
		Major	

Pre-Shipment Inspection

M. Evidence

Item : Interior Flush Door | Dimension (mm) : 44 x 406 x 2438

Thickness	Thickness
 25 January 2023 14:02 Indonesia REVIVE	 25 January 2023 14:04 Indonesia REVIVE
Width	Width
 25 January 2023 14:02 Indonesia REVIVE	 25 January 2023 14:05 Indonesia REVIVE
Length	Length
 25 January 2023 14:03 Indonesia REVIVE	 25 January 2023 14:05 Indonesia REVIVE

Pre-Shipment Inspection

Moisture Content	Moisture Content
	
Stile Size	Mid Rail Size
N/A	N/A
Top Rail Size	Bottom Rail Size
N/A	N/A

Visual Findings

Minor Defect	Major Defect
N/A	N/A



Pre-Shipment Inspection

N. Measurement Check

Product Name		INTERIOR FLUSH DOOR		Dimensions (mm)			
				44 x 610 x 2438			
Item	Thickness (mm)	Width (mm)	Squareness (mm)	Length (mm)	Defects	Finish	Remarks
1	44.04	609	0	2438	-	√	OK
2	44.24	609	0	2438	Dent	√	Repair
3	44.18	609	1	2438	Chipping	√	Repair

O. Moisture Content Check

Product	Specification	Actual Moisture Content (%)			Average (%)	Result
INTERIOR FLUSH DOOR 44 x 610 x 2438	MC Product (8-12%)	8	8	8	9	OK
		9	8.5	9		
		10.5	10	10		

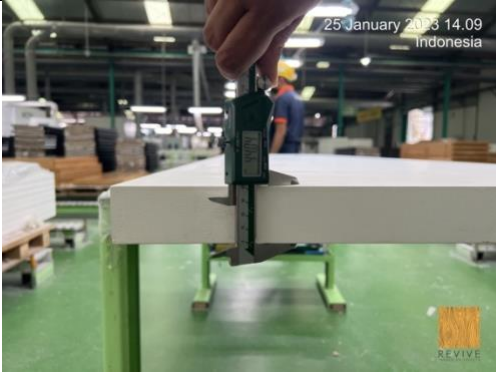
P. Visual Check

Item	Description of Defects	Qty (pcs)	Remarks
1	Coating Crack	1	Minor
2	Chipping		
3	Missed Painting		
4	Uneven Coating		
5	Bubble/Fisheye		
6	Pinhole		
7	Paint Build-up		
8	Dent	1	Minor
9			
Sample check		3 pcs	
Total Defect		Minor	2 pcs
		Major	

Pre-Shipment Inspection

Q. Evidence

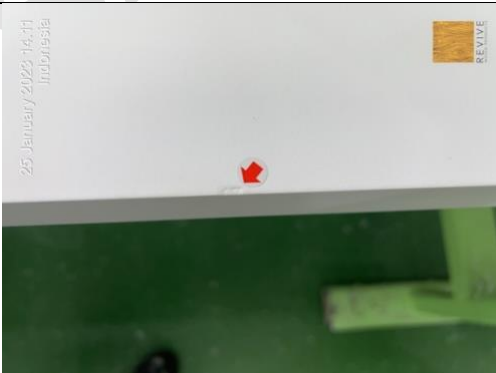
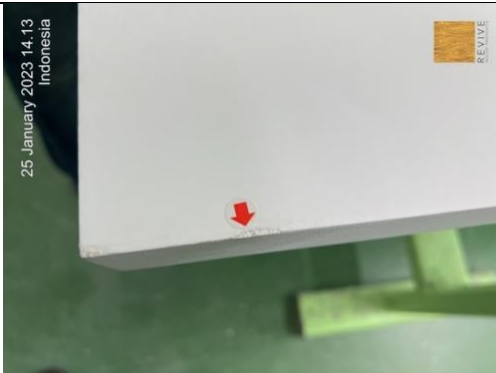
Item : Interior Flush Door | Dimension (mm) : 44 x 610 x 2438

Thickness	Thickness
	
Width	Width
	
Length	Length
	

Pre-Shipment Inspection

Moisture Content	Moisture Content
	
Stile Size	Mid Rail Size
N/A	N/A
Top Rail Size	Bottom Rail Size
N/A	N/A

Visual Findings

Minor Defect	Minor Defect
	



Pre-Shipment Inspection

R. Measurement Check

Product Name		INTERIOR FLUSH DOOR		Dimensions (mm)			
				44 x 813 x 2438			
Item	Thickness (mm)	Width (mm)	Squareness (mm)	Length (mm)	Defects	Finish	Remarks
1	44.28	813	0	2438	-	√	OK
2	43.85	813	1	2439	-	√	OK
3	44.27	813	0	2438	-	√	OK

S. Moisture Content Check

Product	Specification	Actual Moisture Content (%)			Average (%)	Result
INTERIOR FLUSH DOOR 44 x 813 x 2438	MC Product (8-12%)	10	9.5	9	9	OK
		9.5	9	9		
		8.5	8	8.5		

T. Visual Check

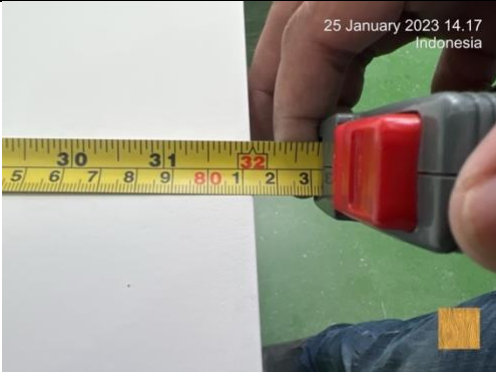
Item	Description of Defects	Qty (pcs)	Remarks
1	Coating Crack		
2	Chipping		
3	Missed Painting		
4	Uneven Coating		
5	Bubble/Fisheye		
6	Pinhole		
7	Paint Build-up		
8			
9			
Sample check		pcs	
Total Defect		Minor	
		Major	



Pre-Shipment Inspection

U. Evidence

Item : Interior Flush Door | Dimension (mm) : 44 x 813 x 2438

Thickness	Thickness
	
Width	Width
	
Length	Length
	

Pre-Shipment Inspection

Moisture Content	Moisture Content
	
Stile Size	Mid Rail Size
N/A	N/A
Top Rail Size	Bottom Rail Size
N/A	N/A

Visual Findings

Minor Defect	Major Defect
N/A	N/A



Pre-Shipment Inspection

Inspector Remarks :

--

Manager : -	Inspector : Revive Wood Products